




Installation for Drago Series I & II Chopping Corn Head Stompers

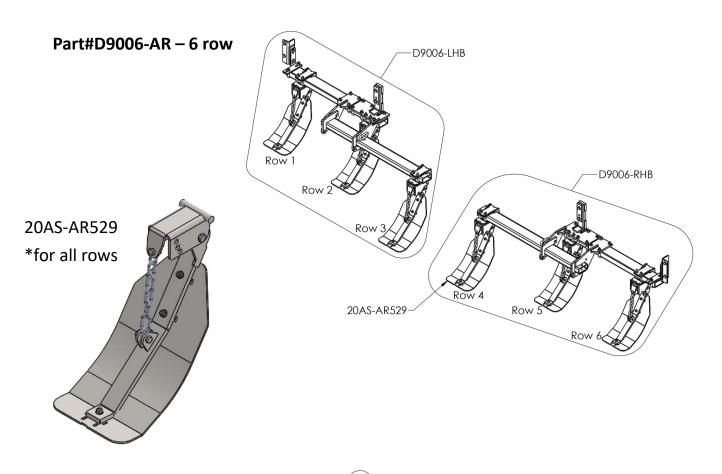


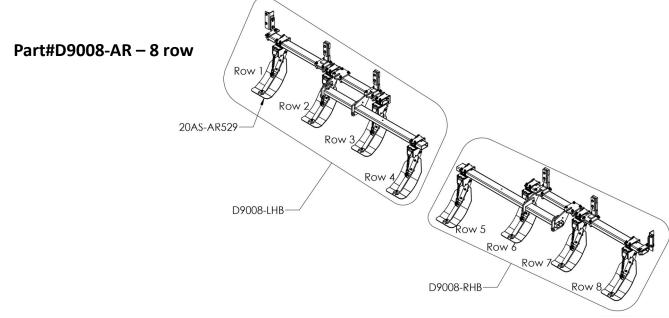

Part#D9012R-AR – 12 row Rigid

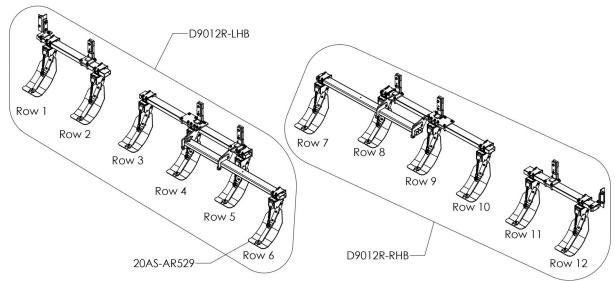




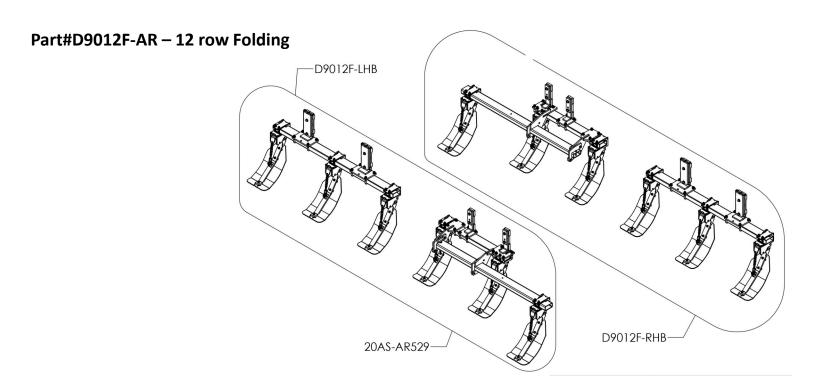

Step 1. Do Not Tighten Bolts or Nuts

Attach Mount Bracket (DC-3000-WL or DC-3000-WR) to corn head using 1/2"-13 x 1-1/2"hex bolts, 1/2" washers,

and 1/2" serrated flange nuts.

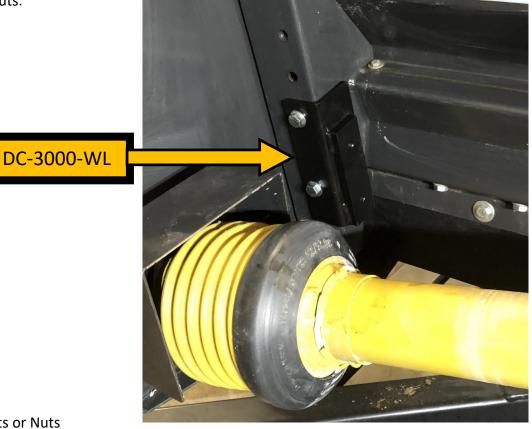

Step 2. Do Not Tighten Bolts or Nuts


Attach Bar Mount (DC-9012) to corn head using 1/2"-13 x 1-1/2" hex bolts, 1/2" washers, and 1/2" lock washers

and the flat plate washer (DC50625).

DC50625

DC-9012

Step 3. Do Not Tighten Bolts or Nuts

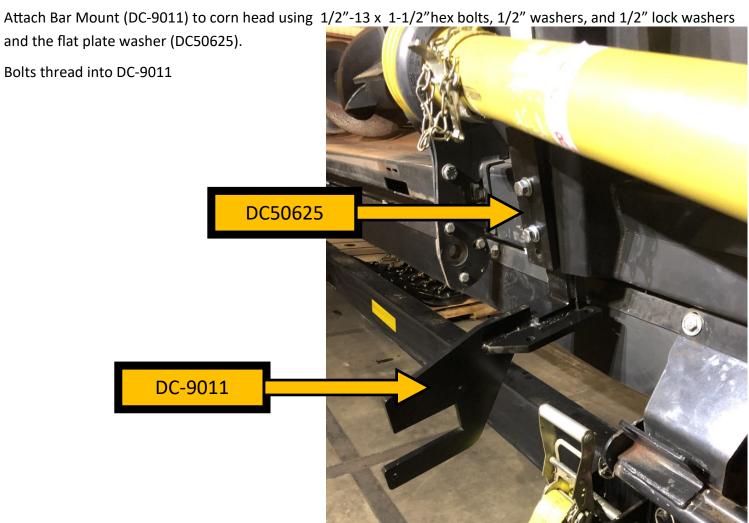

Step 4. Do Not Tighten Bolts or Nuts

Attach Bar 70" Bar (20-9097) to the bar mounts front steps 2 & 3 using U-Bolts and serrated flange nuts.




Step 5. Do Not Tighten Bolts or Nuts

Attach Bar Bracket (20-3013-L or
20-3013-R to Mount Brackets from


Step 1

Use U-Bolts and serrated flange nuts to attached 70" Bar (20-9097) to the bar bracket.

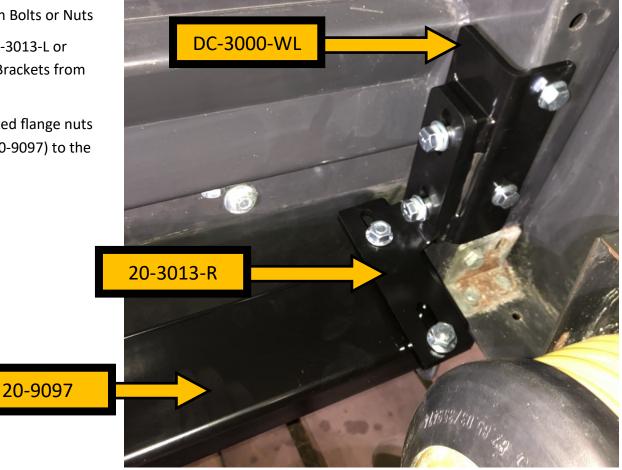


Step 6.

Position 70" Bar (20-9097) so Bolt on Mount (DC-9006) can be lined up with row 3 or row 6 depending which side you are mounting from. Once the bolt on mount is in place, tighten all bolts & nuts from steps 1 through 6.

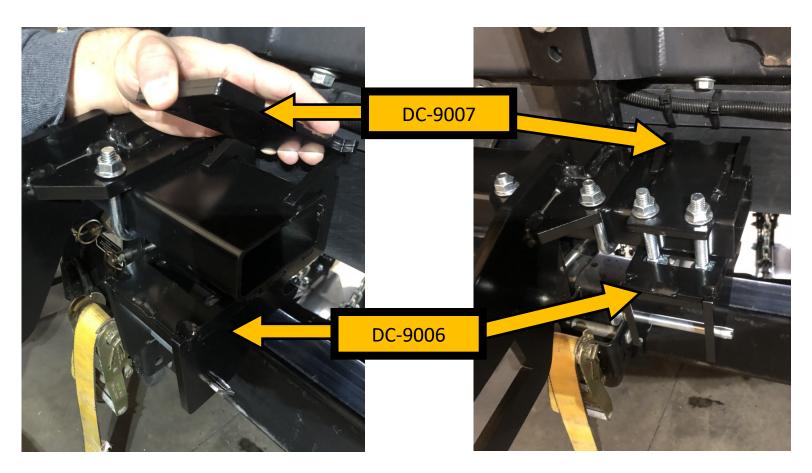

Step 7. Do Not Tighten Bolts or Nuts

Attach Bar Mount (DC-9008) to the 70" Tube between DC-9012 & DC-9011.

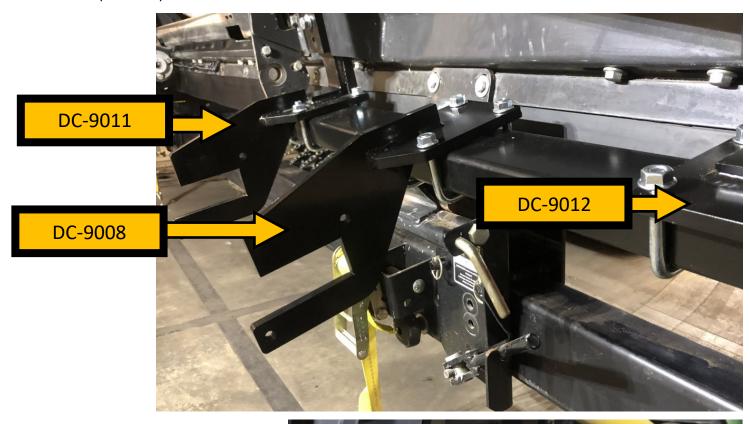

Step 8. Do Not Tighten Bolts or Nuts
Attach 61" Bar (20-9096) and the hanger bolt plate (20-5152)



20-9096



Step 9. Do Not Tighten Bolts or Nuts

Lock the 61" Tube (20-9096) in the in-use position, and attach a bolt on mount to line up with row 4 or 5 (depending which side you are on)

Attach all other bolt on mounts to line up with remaining rows

Tighten all bolts and nuts from steps 7 through 9.